

Vacuum Products Division

IDP 7 / IDP 10 VPI Flange Replacement Kit

INSTRUCTION MANUAL



Manual No. X3807-90013 Rev. A February 2017

Preface

Documentation Conventions


This manual uses the following documentation conventions:

WARNING

Warnings indicate a particular procedure or practice, which if not followed correctly, could lead to serious injury.



CAUTION





NOTE

Notes contain important information.



Before operating or servicing equipment, read and thoroughly understand all operation/maintenance manuals provided by Agilent. Be aware of the hazards associated with this equipment, know how to recognize potentially hazardous conditions, and how to avoid them. Read carefully and strictly observe all cautions and warnings. The consequences of unskilled, improper, or careless operation of the equipment can be serious.

In addition, consult local, state, and national agencies regarding specific requirements and regulations. Address any safety, operation, and/or maintenance questions to your nearest Agilent office.

IDP 7 / IDP 10 VPI Flange Replacement Kit

Part Name	Qty
Rubber Thermal Protector	1
Inlet Fange	1
O-RING 2-151	1
M4x10mm screws	4

Table 1-1 VPI Flange Replacement Kit


Installation:




NOTE: To ensure proper operation, and to prevent damage, the kit must be installed and operated only as specified.

IDP 7 / IDP 10 VPI Flange Replacement Kit

1. Detach the front cowling from the front of the pump by removing three M8x20mm flange bolts using a 6mm T handled hex key.

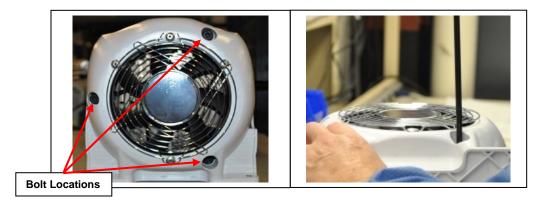


2. Detach the fan cable from the front cowling and remove the cowling from the pump.

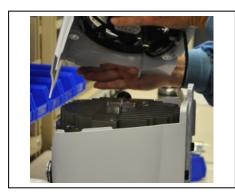





3. Disassemble the rear cowling by remove the six self-tapping screws and two washers that hold the rear cowling to the chassis and front cowling using a Philips head screwdriver.

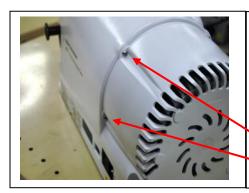





Screw Locations

4. Remove the Rear Cowling from the pump assembly.





5. Loosen the three M6x20mm that secure the top part of the base to the Pump Head.






6. Loosen and remove the two M6x16 mm bolts on the bottom of the base to the pump module using a 5mm hex key. Move the base assembly up enough to facilitate removal of the Rubber Thermal Protector.







7. Remove the thermal rubber protector from the inlet assembly and discard.

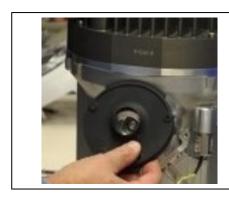



8. Loosen the four M4x10mm screws holding the inlet flange on to the frame. Remove the inlet flange from the top of the frame assembly. Remove the VPI spring and diaphragm from the frame assembly. Remove the O-ring from the assembly and discard.









9. Apply LVP grease and install a new O-Ring into the groove. Install the VPI spring and diaphragm into the frame assembly. Using a 3mm allen wrench, install the four M4x10mm screws holding the inlet flange on to the frame. Torque to 1.6 N.m if a torque wrench is available.







10. Install a new Thermal Rubber Protector onto the inlet assembly.





11. Reseat the base assembly. Verify that all connections are in place and that there are no pinched wires. Tighten the five screws that hold the base assembly in place.








12. Reinstall the rear cowling on to the pump assembly.





IDP 7 IDP 10 VPI Flange Replacement Kit


13. Install the six self-tapping screws and two washers that hold the rear cowling to the chassis and front cowling.

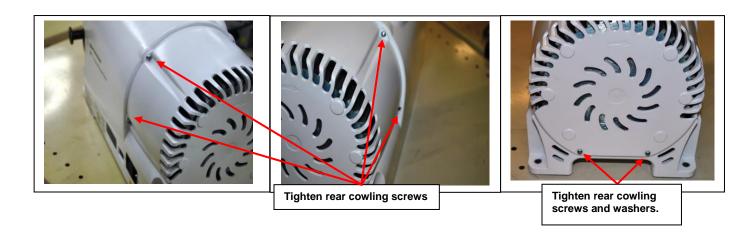

14. Attach the fan cable from the front cowling to the motor.



15. Attach the front cowling to the pump using three M8x20mm flange bolts. Tighten with 6mm Hex Key. Torque screws to 11.3 Nm if a torque wrench is available.

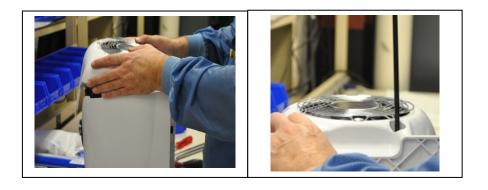

16. Power the pump up to insure it is functioning correctly.





Vacuum Products Division Instructions for returning products

please visit our website for individual office

information http://www.DJLOHQW.com

Dear Customer:

Please follow these instructions whenever one of our products needs to be returned.

- 1) Complete the attached Request for Return form and send it to Agilent Technologies (see below), taking particular care to identify all products that have pumped or been exposed to any toxic or hazardous materials.
- 2) After evaluating the information, Agilent Technologies will provide you with a Return Authorization (RA) number via email or fax, as requested.
 - Note: Depending on the type of return, a Purchase Order may be required at the time the Request for Return is submitted. We will quote any necessary services (evaluation, repair, special cleaning, eg).
- 3) Important steps for the shipment of returning product:
 - x Remove all accessories from the core product (e.g. inlet screens, vent valves).
 - x Prior to shipment, drain any oils or other liquids, purge or flush all gasses, and wipe off any excess residue.
 - x If ordering an Advance Exchange product, please use the packaging from the Advance Exchange to return the defective product.
 - x Seal the product in a plastic bag, and package product carefully to avoid damage in transit. You are responsible for loss damage in transit.
 - x Agilent Technologies is not responsible for returning customer provided packaging or containers.
 - x Clearlylabel package with RA number. Using the shipping label provided will ensure the proper address and RA number are on the package. Packages shipped to Agilent without a RA clearly written on the outside cannot be accepted and will be returned.
- Return only products for which the RA was issued.
- 5) Product being returned under a RA must be received within 15 business days.
- 6) Ship to the location specified on the printable label, which will be sent, along with the RA number, as soon as we have received all of the required information. Customer is responsible for freight charges on returning product.
- 7) Return shipments must comply with all applicable Shipping Regulations (IATA, DOT, etc.) and carrier requirements.

RETURN THE COMPLETED REQUEST FOR RETURN FORM TO YOUR NEAREST LOCATION:

EUROPE: NORTH AMERICA: PACIFIC RIM:

Fax: 00390119979

330

Fax Free: 00 800 345 345

TollFree: 800 882 7426, Option 3 00

Fax:

vpl-ra@agilent.com

17818609252

Toll Free: 0080023423400

vpt-

customercare@agilent.com



Vacuum Products Division Request for Return Form (Health and Safety Certification)

Please read important policy information on Page 3 that applies to all returns.

Company Name:		Contact Name:			
Tel:	Email:	Fax:			
Customer Ship To:		Customer Bill To:			
Europe only: VAT reg. Number:		USA/Canada only: Taxable		e Non-taxable	
PRODUCT IDENTIFICATION					
Product Description	Agilent P/N	Agilent S/N		Origina	al Purchasing Reference
				-	
		t/Demo	ŧvalu: BIOLOGICA		Return for Credit
AGILENT TECHNOLOGIES CAN RADIOACTIVE MATERIAL, OR I Call Agilent Technologies to di The equipment listed above (o	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. iscuss alternatives if this reque check one): ed or been exposed to any to	CONTAMINATED WITH E irement presents a problem. Divic or hazardous materi	BIOLOGICA lem. als. OR	AL OR E	EXPLOSIVE HAZARDS,
AGILENT TECHNOLOGIES CAN RADIOACTIVE MATERIAL, OR I Call Agilent Technologies to di The equipment listed above (o HAS NOT pump HAS pumped or	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. iscuss alternatives if this requ check one):	CONTAMINATED WITH E irement presents a problem oxic or hazardous materiatoxicor hazardous mate	BIOLOGICA lem. als. OR rials. If this	AL OR E	EXPLOSIVE HAZARDS,
AGILENT TECHNOLOGIES CAN RADIOACTIVE MATERIAL, OR I Call Agilent Technologies to di The equipment listed above (o HAS NOT pump HAS pumped or	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. iscuss alternatives if this requestheck one): ed or been exposed to any to been exposed to the following stalsobe filledout. Checkbox	CONTAMINATED WITH E irement presents a problem oxic or hazardous materiatoxicor hazardous mate	BIOLOGICA lem. als. OR rials. If this	AL OR E	checked, the following apedor was exposed:
HAS pumped or information mu	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. iscuss alternatives if this requestheck one): led or been exposed to any to been exposed to the following stalsobe filledout. Checkbox	irement presents a problem is a problem in the control of the cont	BIOLOGICA lem. als. OR rials. If this chproduct	sboxis (s)pum	checked, the following apedor was exposed:
AGILENT TECHNOLOGIES CAN RADIOACTIVE MATERIAL, OR I Call Agilent Technologies to di The equipment listed above (o HAS NOT pump HAS pumped or information mu Toxic Corrosive	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. iscuss alternatives if this requestheck one): ed or been exposed to any to been exposed to the following stalsobe filled out. Check box Reactive Flammials. Include product name, check the contaminated with a toxic of handling of the product, and is liable for the contaminated with a toxic of the contaminated wit	irement presents a problem is a problem in the presents a problem is a problem in the problem in the problem is a problem in the problem in the problem is a problem in the problem	als. OR rials. If this chproduct Bic ical symbols not disclose	sboxis (s)pum blogica ol or fo	checked, the following apedor was exposed: Radioactive rmula: Responsible for second party occurring a second party
AGILENT TECHNOLOGIES CAN RADIOACTIVE MATERIAL, OR I Call Agilent Technologies to di The equipment listed above (c HAS NOT pump HAS pumped or information mu Toxic Corrosive List all toxic/hazardous mater NOTE: If a product is received at Agile all costs incurred to ensure the safe a result of exposure totoxic or hazardo Print Name:	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. iscuss alternatives if this requested or been exposed to any to been exposed to the following stalsobe filled out. Checkbox Reactive Flammials. Include product name, chandling of the product, and is liable four materials present in the product.	irement presents a problem is a problem in the presents a problem is a problem in the problem in the problem is a problem in the problem in the problem is a problem in the problem	als. OR rials. If this chproduct Bic ical symbols not disclose	Sboxis (s)pum blogica bl or fo	checked, the following apedor was exposed: Radioactive rmula: Responsible for second party occurring a second party
AGILENT TECHNOLOGIES CAN RADIOACTIVE MATERIAL, OR I Call Agilent Technologies to di The equipment listed above (o	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. Iscuss alternatives if this required or been exposed to any to been exposed to the following stalsobe filledout. Checkbox Reactive Flammalials. Include product name, chandling of the product, and is liable for us materials present in the product. Authorized Signation	irement presents a problem oxic or hazardous materiatoxicor hazardous materiatoxicor hazardous materials to which mable Explosive nemical name, and chemor hazardous material that was or any harmorinjury to Agilenture:	als. OR rials. If this chproduct Bic ical symbols not disclose	Sboxis (s)pum blogica bl or fo	checked, the following apedor was exposed: Radioactive rmula: Responsible for second party occurring a second party
AGILENT TECHNOLOGIES CAN RADIOACTIVE MATERIAL, OR I Call Agilent Technologies to di The equipment listed above (o	NOT ACCEPT ANY PRODUCTS MERCURY AT ITS FACILITY. iscuss alternatives if this requested or been exposed to any to been exposed to the following stalso be filled out. Check box Reactive Flammals. Include product name, chandling of the product, and is liable for us materials present in the product. Authorized Signation.	irement presents a problem oxic or hazardous materiatoxicor hazardous materials to which mable Explosive memical name, and chemor hazardous material that was or any harmorinjury to Agilenture:	als. OR rials. If this chproduct Bic ical symbols not disclose	Sboxis (s)pum blogica bl or fo	checked, the following apedor was exposed: Radioactive rmula: Responsible for second party occurring a second party



Vacuum Products Division Request for Return Form (Health and Safety Certification)

Please use these Failure Mode to describe the concern about the product on Page 2.

TURBO PUMPS and TURBO CONTROLLERS

APPARENT DEFECT/MALFUNCTION		POSITION	PARAMETERS	
- Does not start	- Noise	- Vertical	Power:	Rotational Speed:
- Does not spin freely	- Vibrations	-Horizontal	Current:	Inlet Pressure:
- Does not reach full speed	-Leak	-Upside-down	Temp 1:	Foreline Pressure:
- Mechanical Contact	-Overtemperature	-Other:	Temp 2:	Purge flow:
- Cooling defective	-Clogging		OPERATING TIME:	

ON PUMPS/CONTROLLERS

- Bad feedthrough	- Poorvacuum
- Vacuumleak	- High voltageproblem
- Error code on display	- Other

LEAK DETECTORS

- Cannot calibrate	-No zero/high background
- Vacuum systemunstable	- Cannot reach testmode
- Failedto start	- Other

SCROLL AND ROTARY VANE PUMPS

- Pump seized	- Other
- Doesn't reach vacuum	- Over temperature
- Pump doesn't start	 Noisy pump (describe)

VALVES/COMPONENTS

- Main seal leak	-Bellows leak
- Solenoidfailure	- Damagedflange
- Damagedsealingarea	-Other

INSTRUMENTS

- Gaugetubenotworking	- Displayproblem
- Communicationfailure	-Degasnot working
- Errorcodeondisplay	-Other

DIFFUSION PUMPS

- Heater failure	- Electrical problem
- Doesn't reach vacuum	- Cooling coil damage
- Vacuumleak	- Other

Section 6) ADDITIONAL TERMS

Please read the terms and conditions below as they apply to all returns and are in addition to the Agilent Technologies Vacuum Product Division – Products and Services Terms of Sale.

- x Customer is responsible for the freight charges for the returning product. Returnshipments must comply with all applicable **Shipping Regulations** (IATA, DOT, etc.) and carrier requirements.
- x Customers receiving an Advance Exchange product agree to return the defective, rebuildable part to Agilent Technologies within15businessdays. Failuretodoso, or returning a non-rebuildable part (crashed), will result in an invoice for the non-returned/non-rebuildable part.
- x Returns for credit toward the purchase of new or refurbished Products are subject to prior Agilent approval and may incur a restocking fee. Please reference the original purchase order number.
- x Units returned for evaluation will be evaluated, and a quote for repair will be issued. If you choose to have the unit repaired, the cost of the evaluation will be deducted from the final repair price should be issued within 3 weeks of quotation date. Units without a Purchase Order for repair will be returned to the customer, and the evaluation fee will be invoiced.
- x A Special Cleaning fee willapply to all exposed products per Section 4 of this document.
- x If requesting a calibration service, units must be functionally capable of being calibrated.

Agilent Technologies

Vacuum Product Division

United States & Canada

Agilent Technologies Vacuum Products Division 121 Hartwell Avenue Lexington, MA 02421 USA Tel: +1 781 861 7200 Toll-Free: +1 800 882 7426

Fax: +1 871 860 5437

Benelux

Agilent Technologies Vacuum Products Division Herculesweg 8 4338 PL Middelburg THE NETHERLANDS Tel: +31 118 671570 Fax: +31 118 671569

China

Agilent Technologies
Vacuum Products Division
Room 1648
Central Tower South Wing
Beijing Junefield Plaza
No. 10 XuanWuMenWai Street
Beijing 100052 P.R. CHINA
Tel.: +86 (10) 6310 8550
Toll-Free: 800 820 6556
Fax: +86 (10) 6310 0141

France

Agilent Technologies
Vacuum Products Division
7 avenue des Tropiques
Z.A. de Courtaboeuf - B.P. 12
91941 Les Ulis cedex FRANCE
Tel.: +33 (0) 1 69 86 38 84
Fax: +33 (0) 1 69 86 29 88

Germany & Austria

Agilent Technologies Vacuum Products Division Alsfelder Strasse 6 Postfach 11 14 35 64289 Darmstadt GERMANY Tel.: +49 (0) 6151 703 353

Fax: +49 (0) 6151 703 302

India

Agilent Technologies Vacuum Product Division 205-A, "A" wing of Galleria, 2nd floor, Hiranandani Gardens, Powai, Mumbai-400 076, India Tel.: +91 22-2570 8595 / 8597 Fax: +91 22- 2570 8599

Italy

Agilent Technologies
Vacuum Products Division
via F.lli Varian 54
10040 Leini, (Torino) ITALY
Tel.: +39 011 997 9111
Toll-Free: 00 800 234 234 00
Fax: +39 011 997 9350

Japan

Agilent Technologies
Vacuum Products Division
Sumitomo Shibaura Building 4-16-36
8th Floor
4-16-36 Shibaura Minato-ku
Tokyo 108 JAPAN
Tel.: +81 3 5232 1253
Toll-Free: 0120 655 040

Korea

Agilent Technologies
Vacuum Products Division
Shinsa 2nd Bldg. 2F 966-5
Daechi-dong
Kangnam-gu, Seoul
KOREA 135-280
Tel.: +82 2 3452 2452
Toll-Free: 080 222 2452

Fax: +82 2 3452 2451

Fax: +81 3 5232 1710

Mexico

Agilent Technologies Vacuum Products Division Concepcion Beistegui No 109 Col Del Valle C.P. 03100 MEXICO, D.F.

Tel.: +52 5 523 9465 Fax: +52 5 523 9472

Southeast Asia

Agilent Technologies
Vacuum Products Division
South East Asia (SEA) - Alex Ho
H/P: +601 2213 1253
Fax: +603 6733 8121

Singapore

Agilent Technologies
Vacuum Products Division
Singapore
Unit 10-04 Helios
Biopolis @ one-north
11 Biopolis Way, 138667
Singapore
H/P.: +65 92364988
Fax: +65 64789603

Taiwan

Agilent Technologies
Vacuum Products Division
14F-6, No. 77, Hsin Tai Wu Road,
Sec. 1
Hsi chih, Taipei Hsien, Taiwan,
R.O.C.
Tel.: +886 2 2698 9555

Tel.: +886 2 2698 9555 Toll Free: 0800 051 342 Fax: +886 2 2698 9678

UK & Ireland

Agilent Technologies Vacuum Products Division 6 Mead Road Oxford Industrial Park Tel.: +44 (0) 1865 291570 Fax: +44 (0) 1865 291

